


TM25 (KV25) INSTRUCTION MANUAL

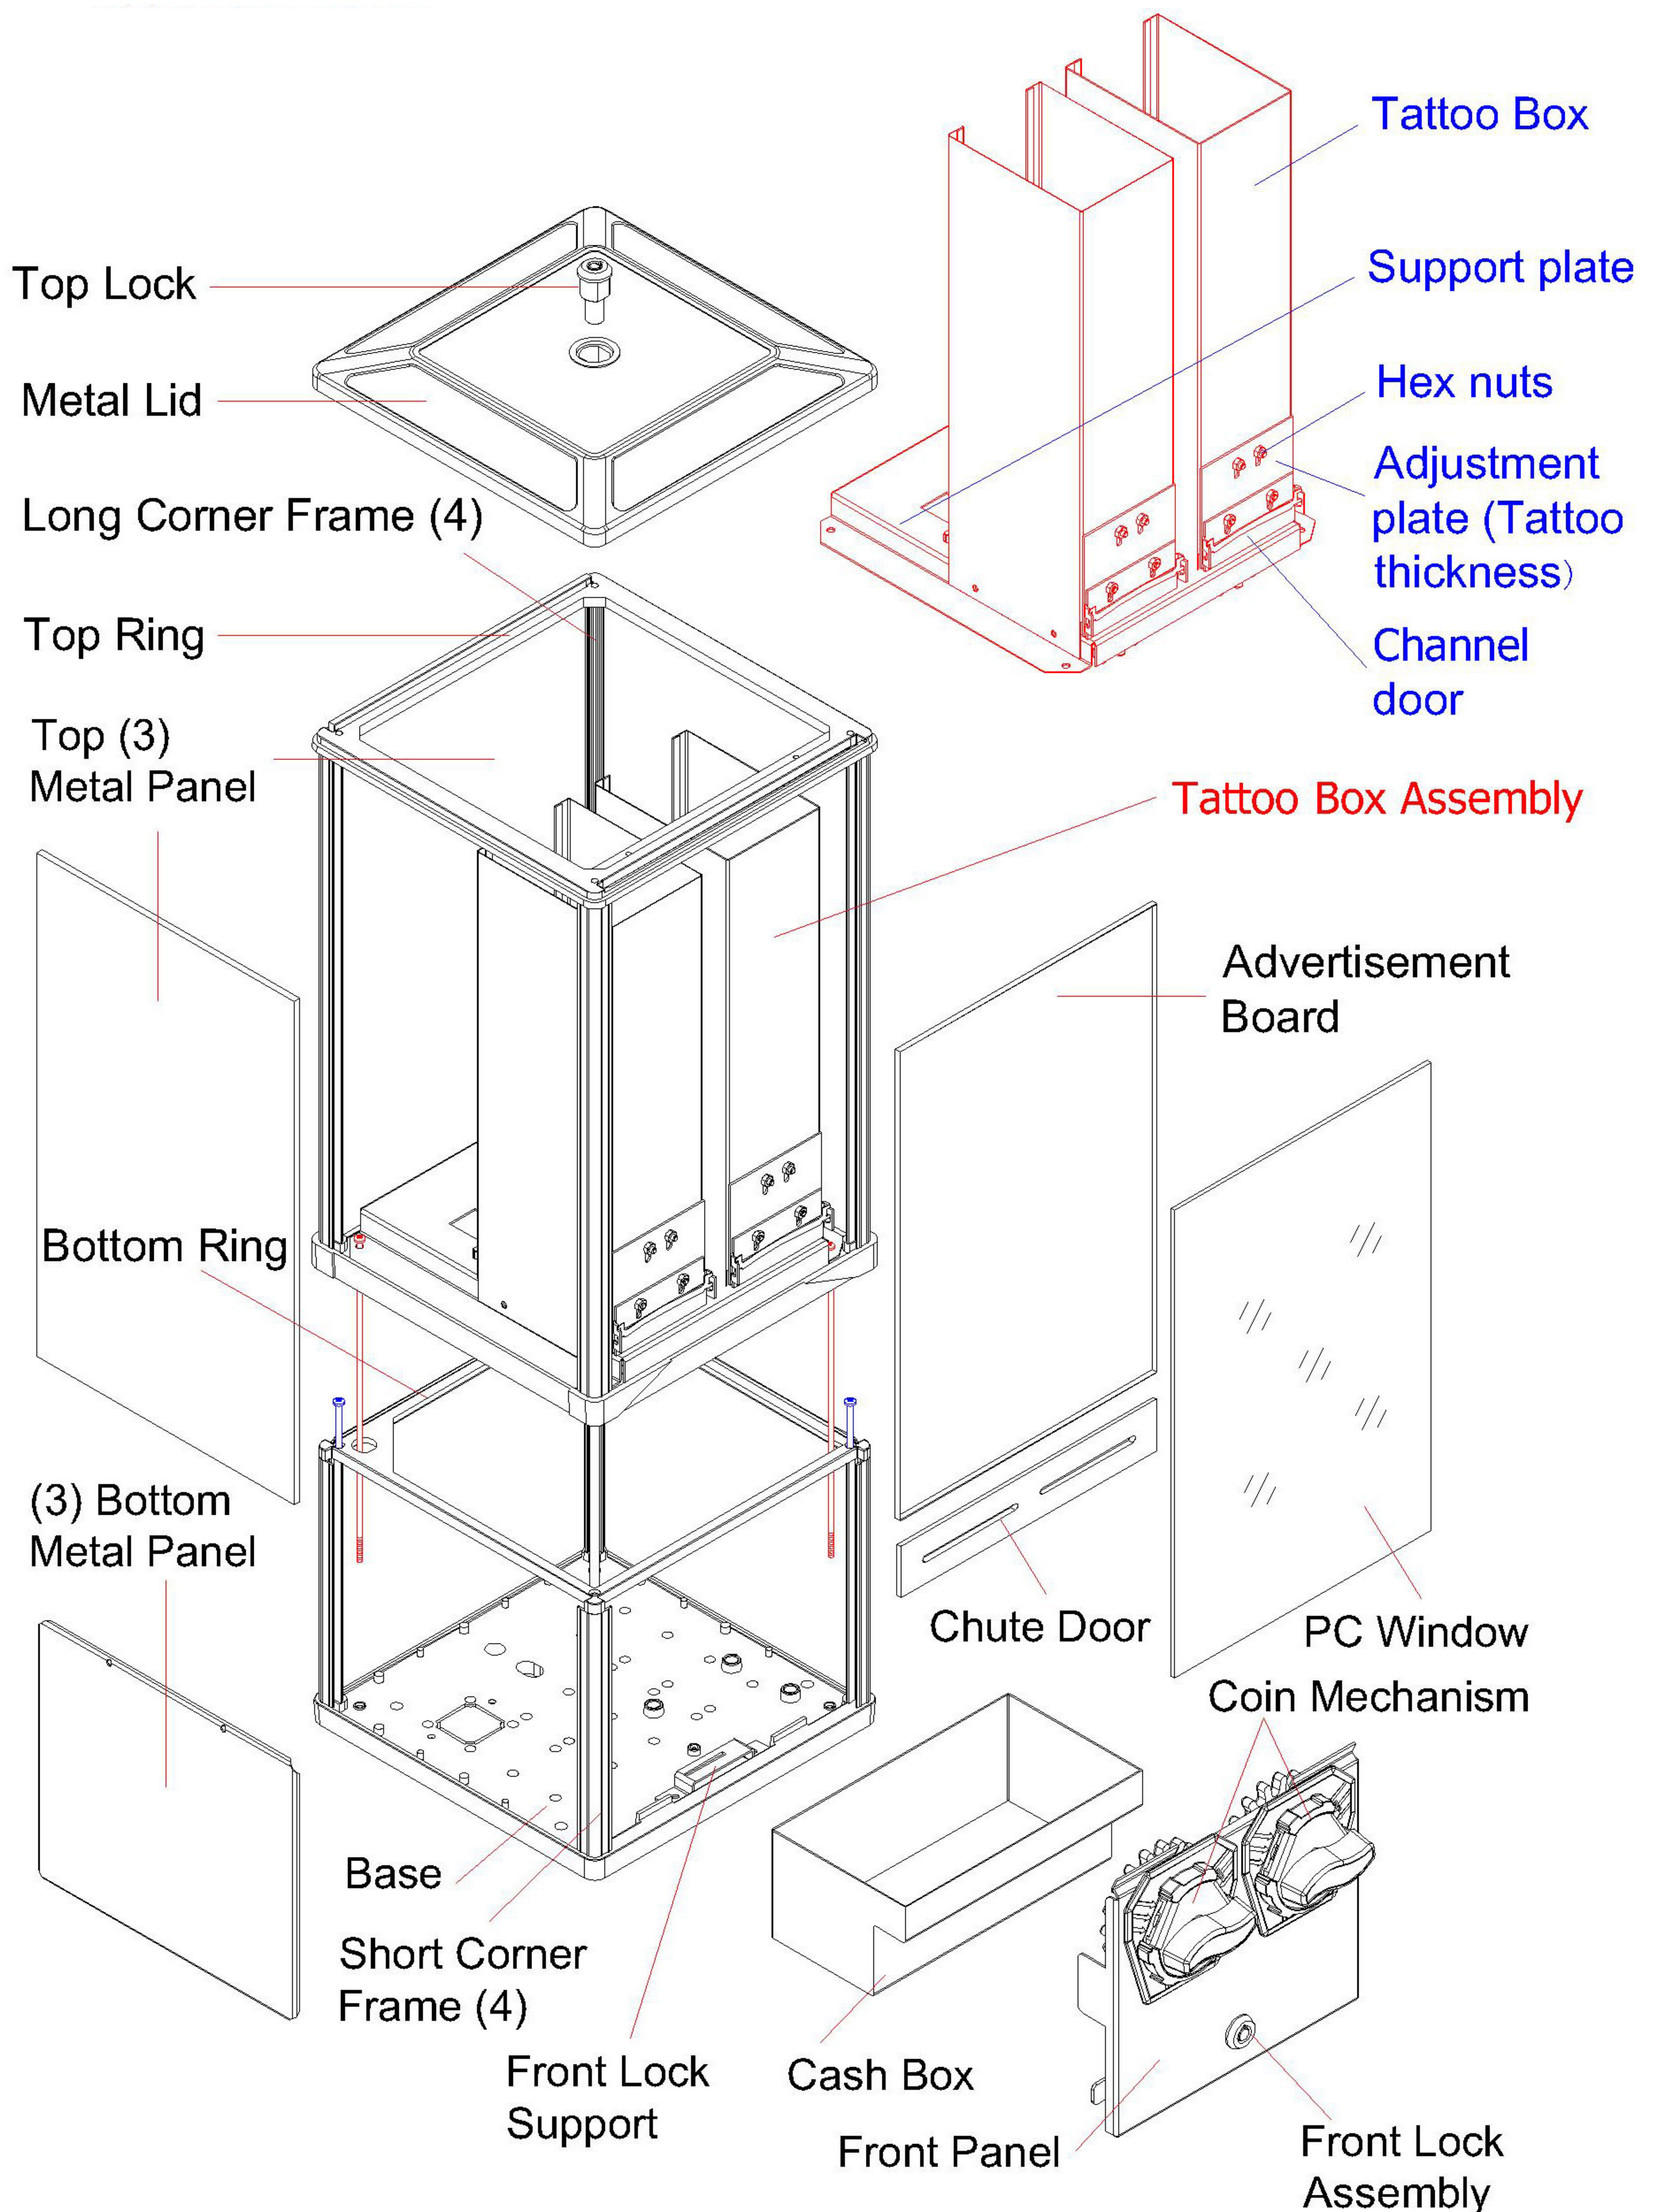

Initial set-up

1. To change Tattoo sticker settings:

- A)Unlock and remover metal lid.
- B)Remove the advertisement board and PC window.
- C)Remove the chute door from the body.
- D)Remove the(8) hex nuts and channel door from the tattoo boxes (Fig.1).
- E)Then click the arrow to adjust the thickness of the tattoo stickers (1.5 times).
- F)Replace parts in step A-E in reverse order.

Figure 1

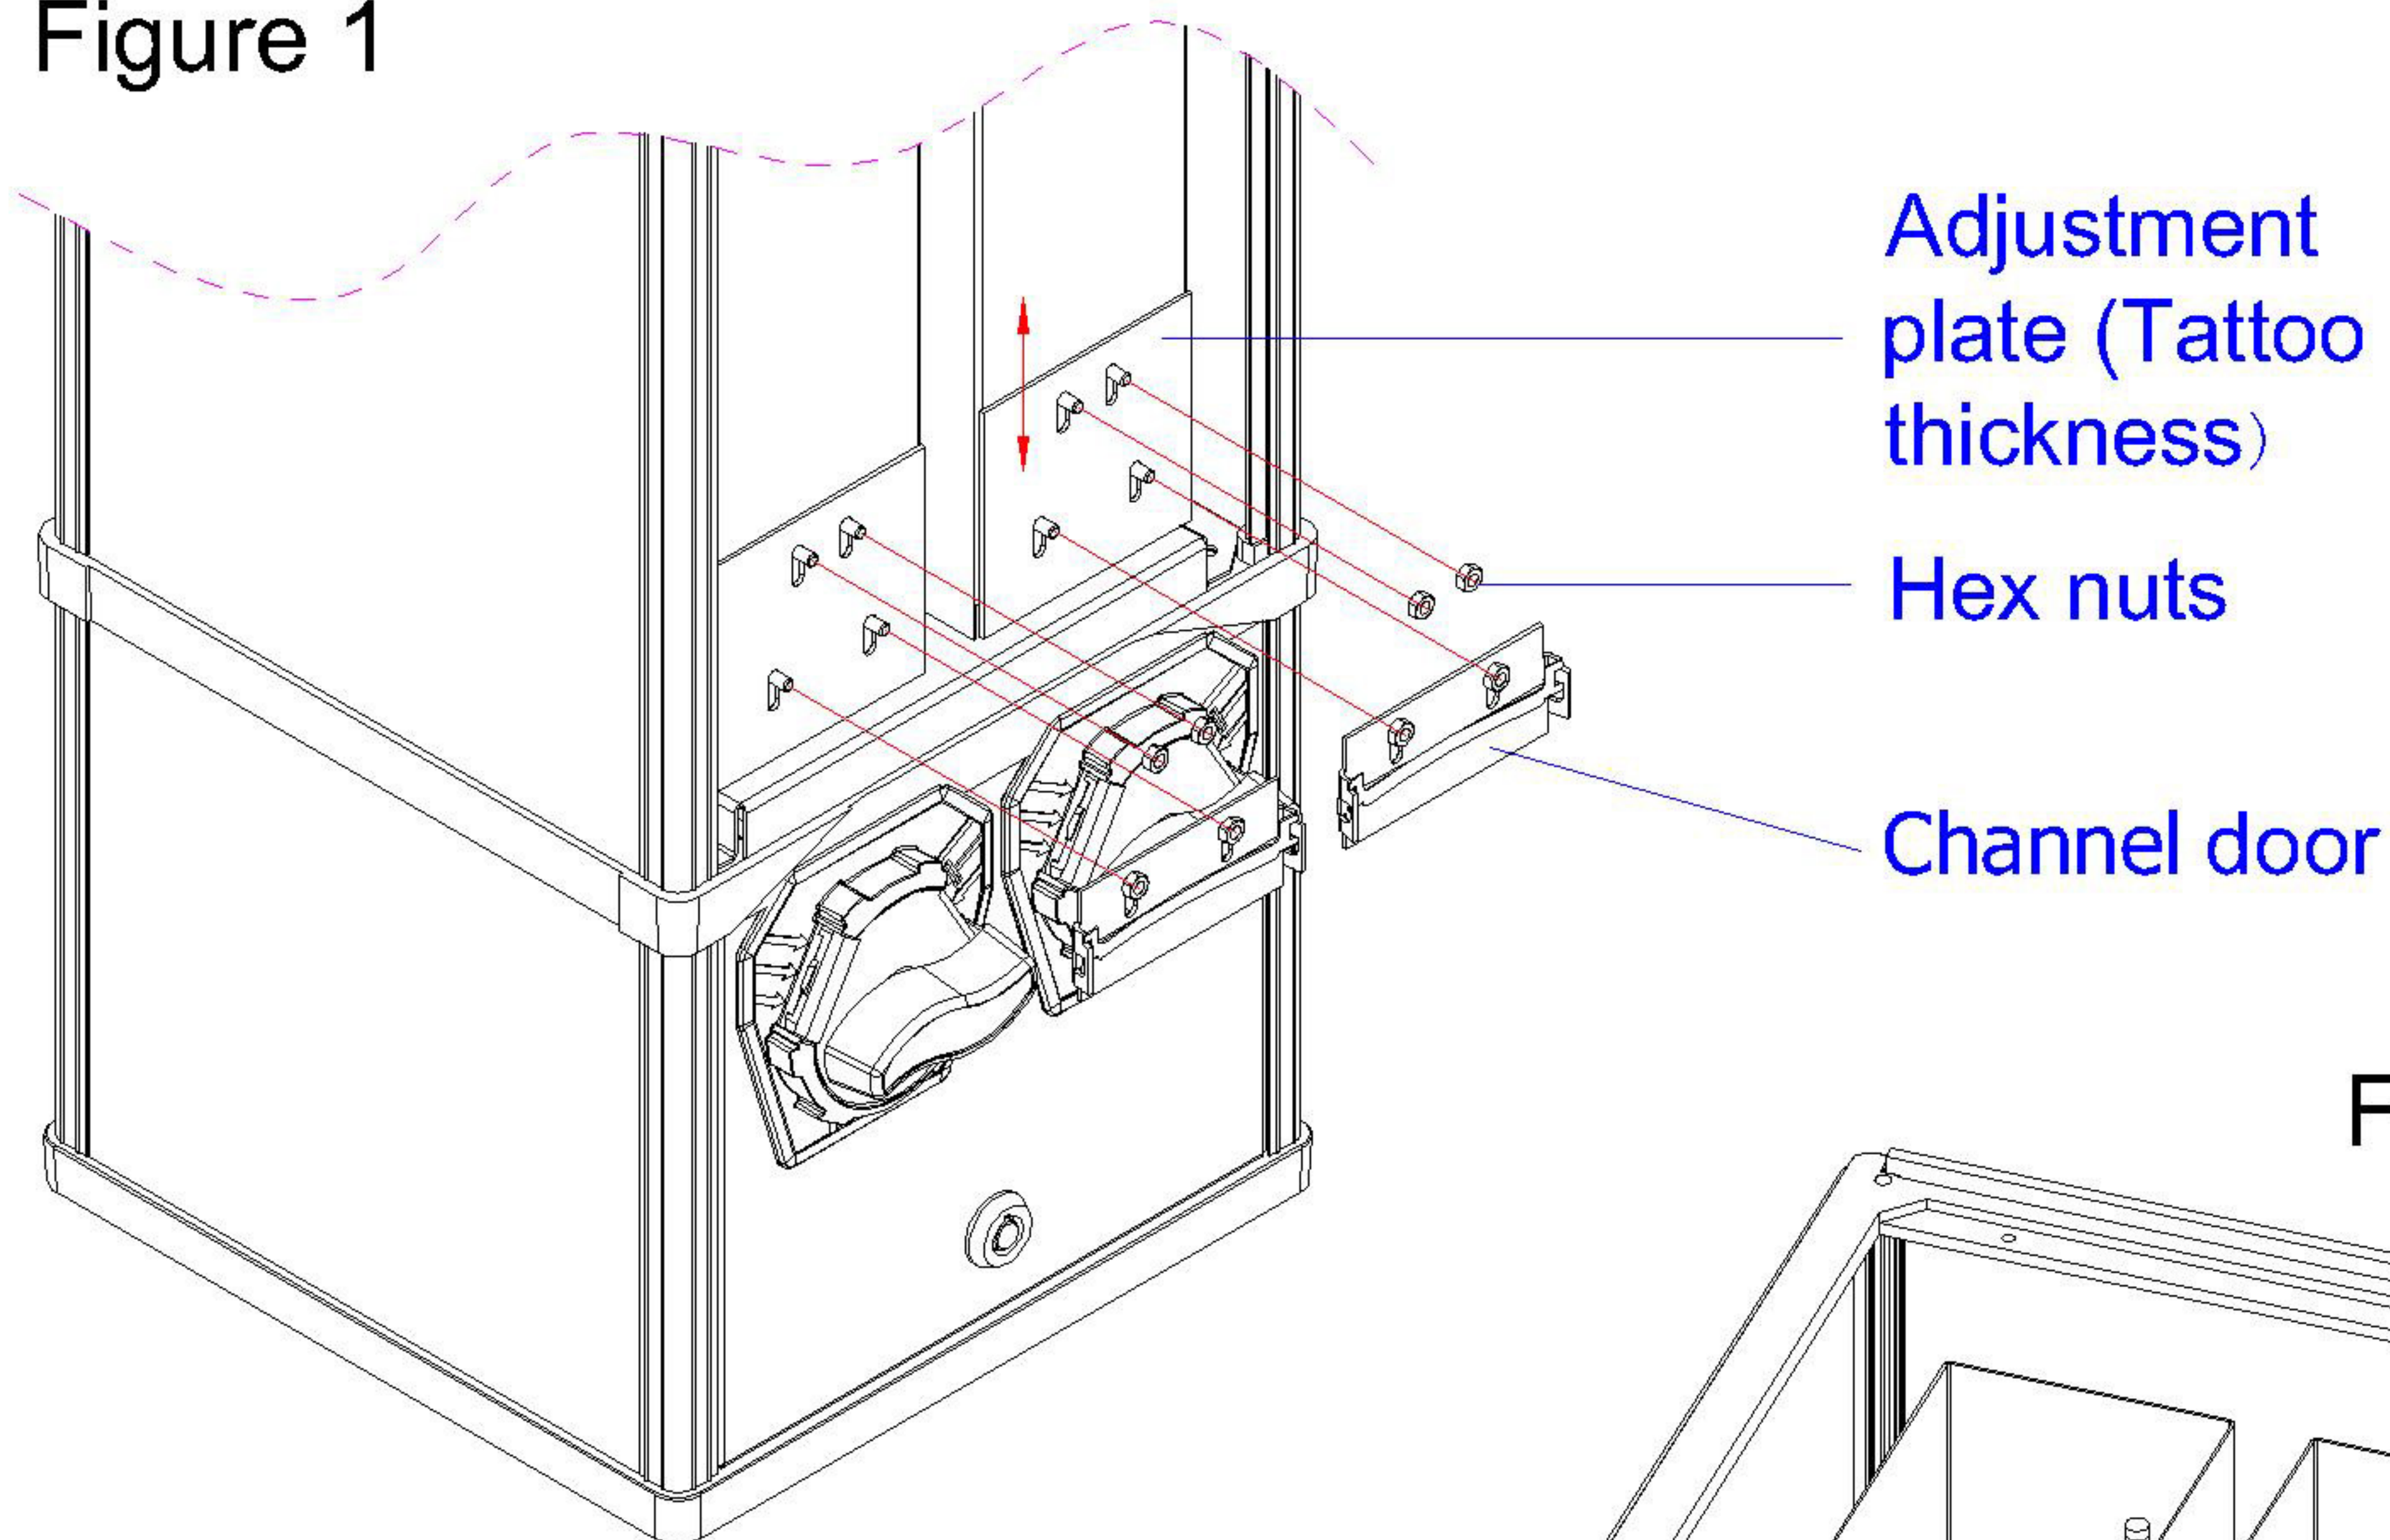




Figure 2

2. To fill it up with tattoo sticker :

- A)Unlock and remover metal lid.
- B)Remove the weight (Fig.2).
- C)Stack into the tattoo sticker.
- D)Replace parts in step A-C in reverse order.

Warning:

**The tattoo sticker size 12 X 7 CM thickness is less than 5 mm,
The small size of the card need to use auxiliary products to sell**

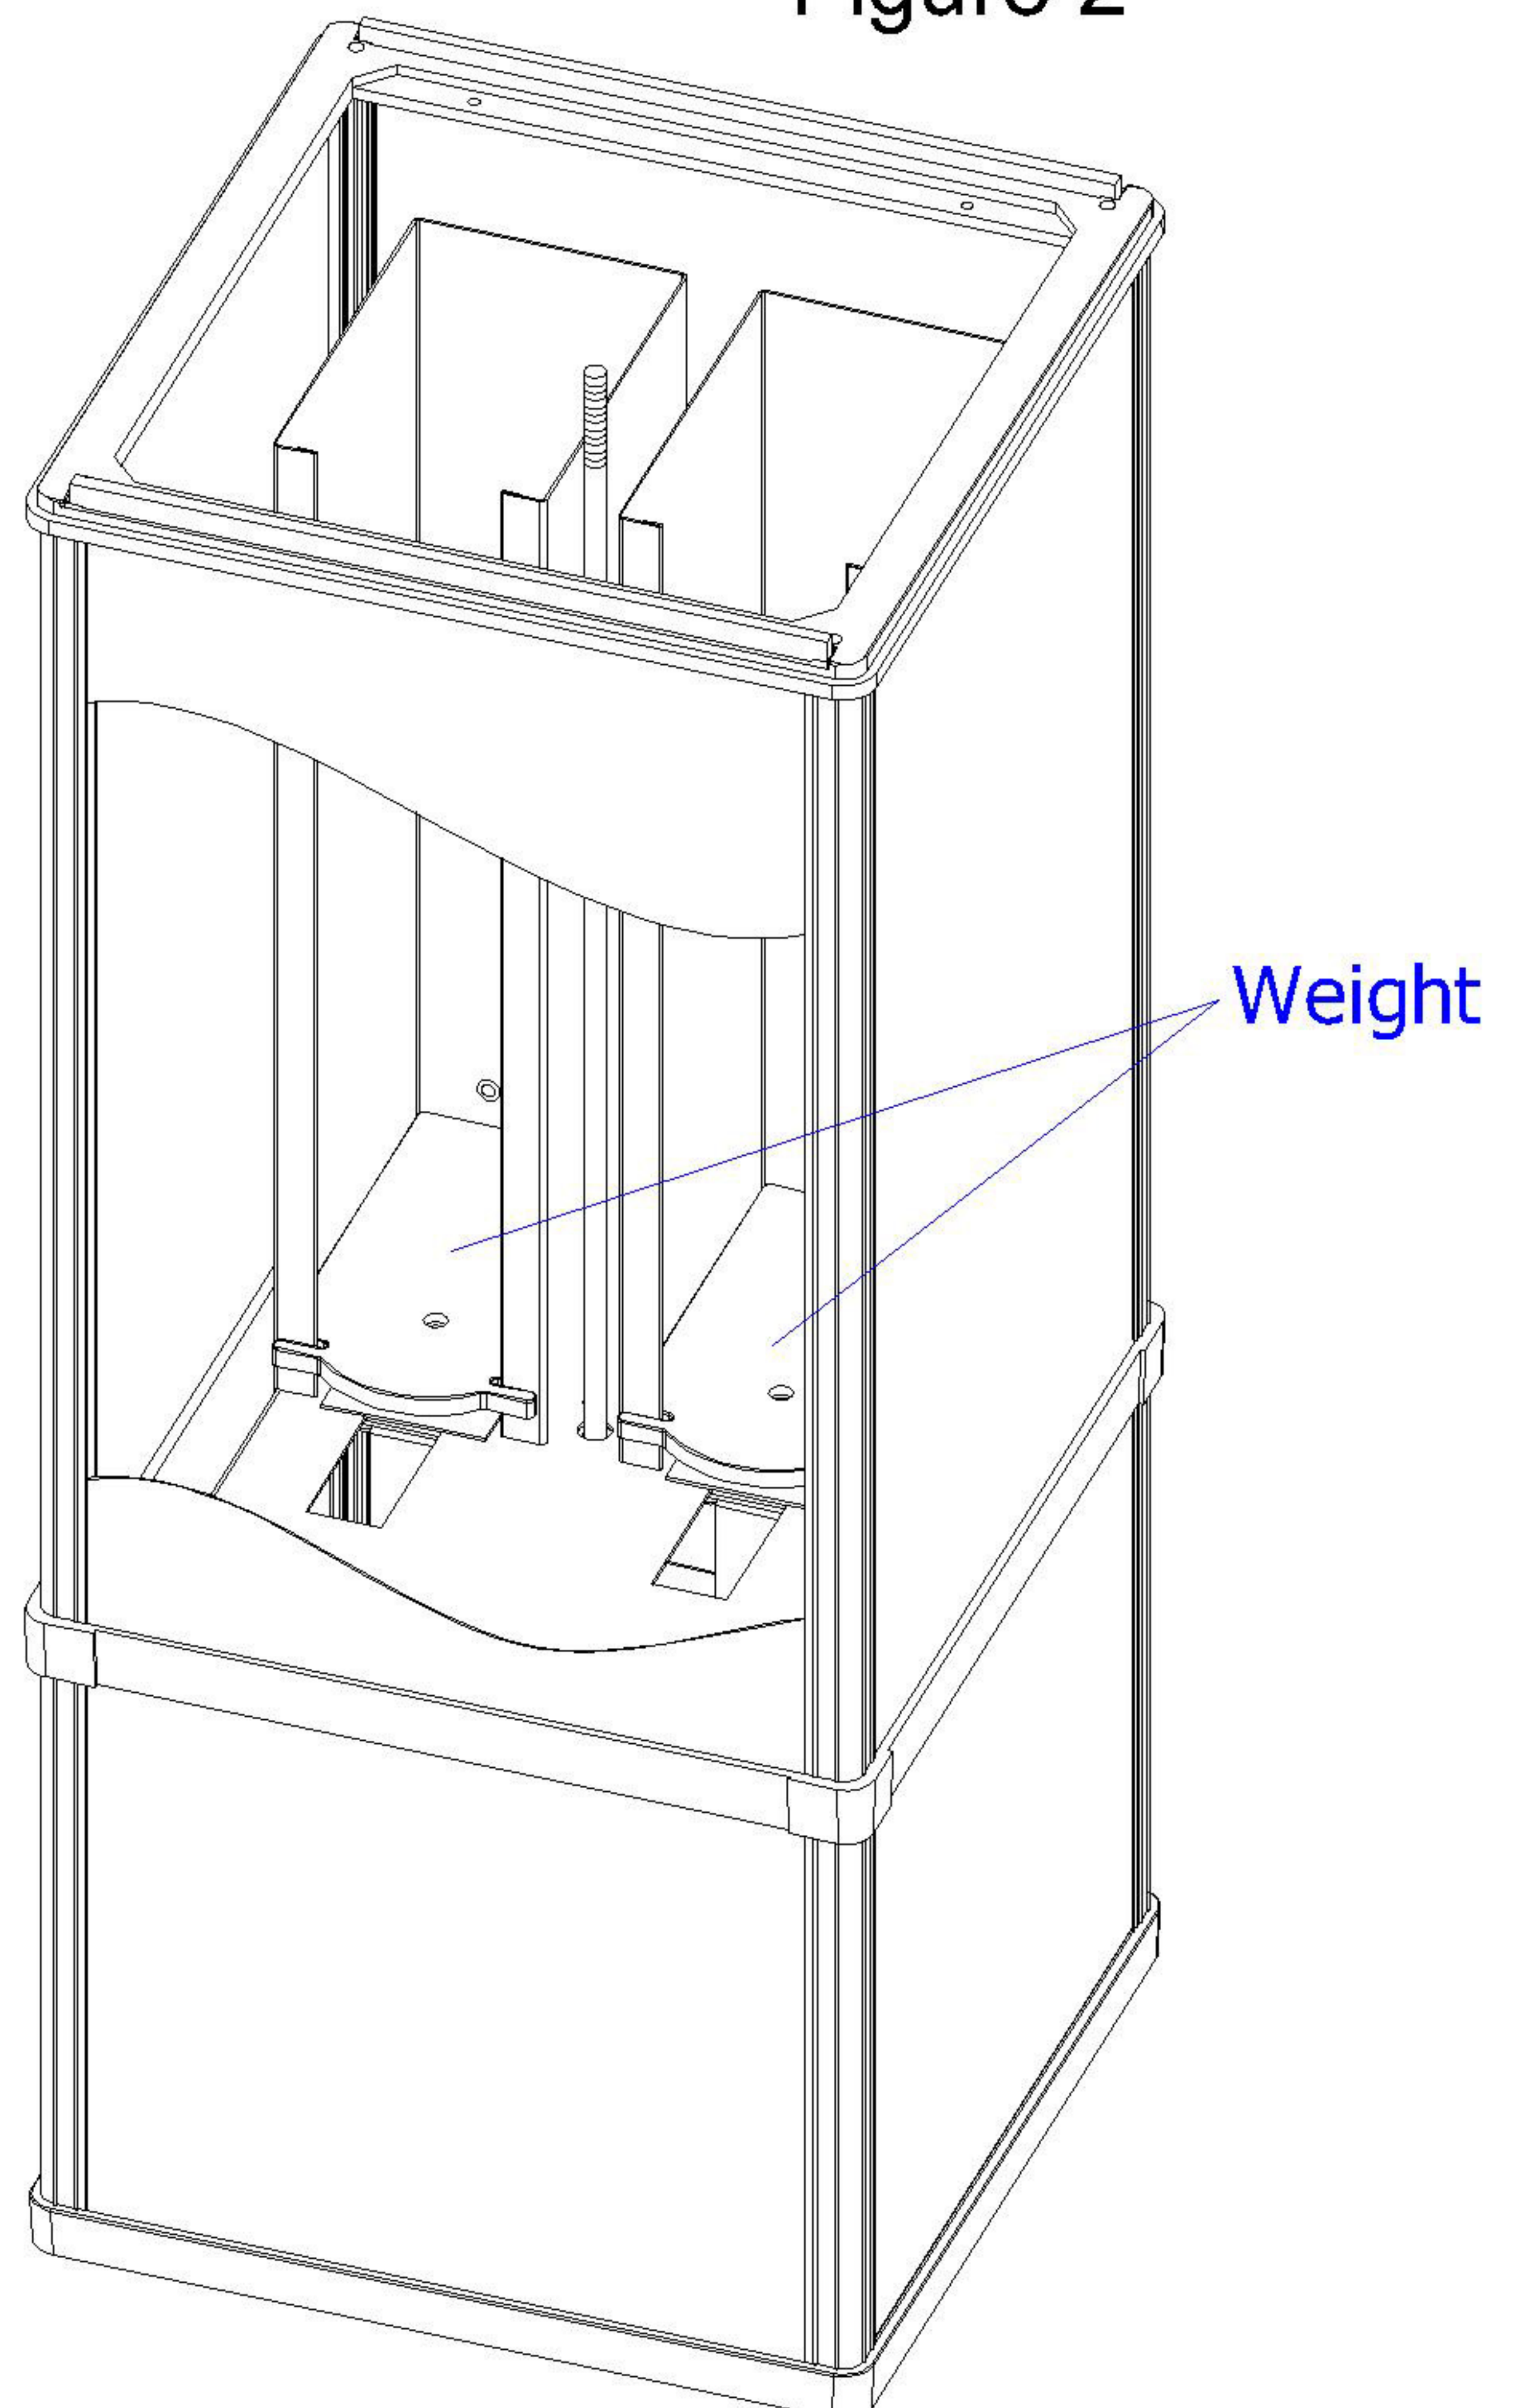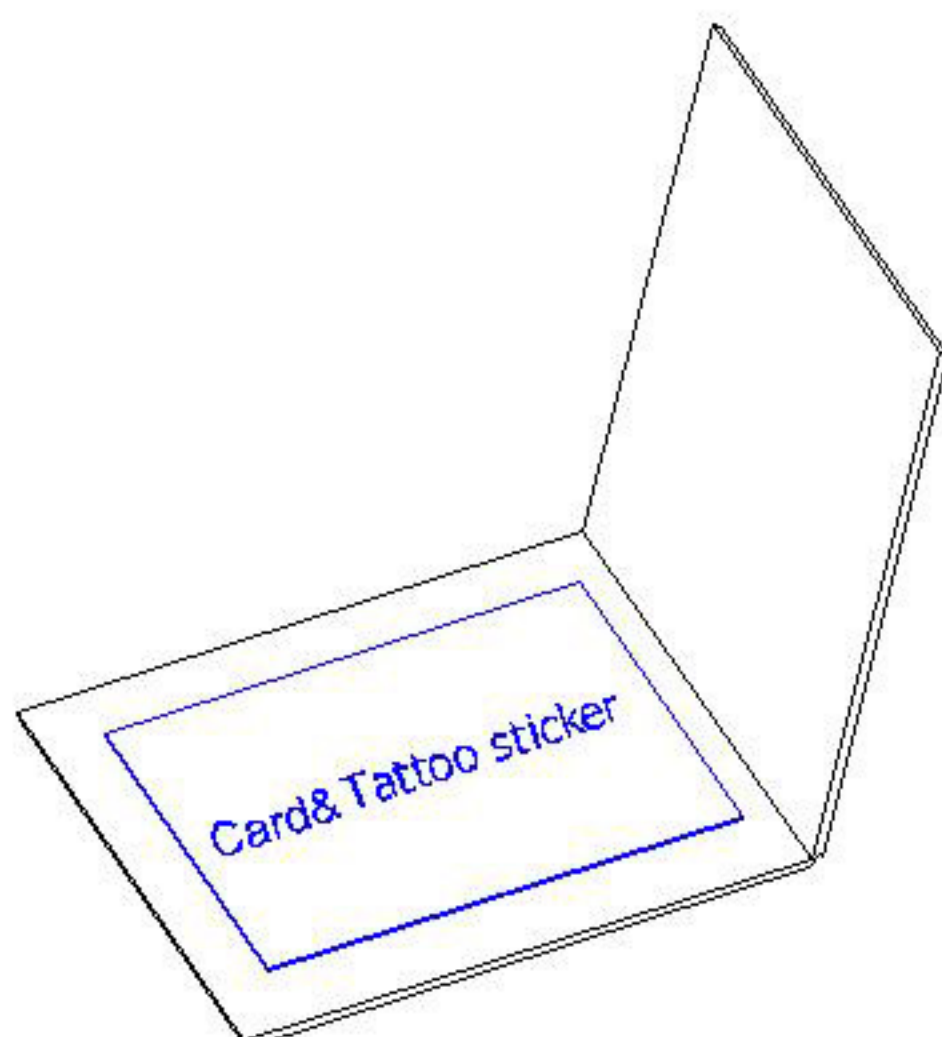

Coin Mechanism


The coin mechanism (Fig. 4) can be removed by removing the globe lid and lifting off the globe assembly. Once the globe assembly is removed, the coin mechanism can now be lifted upwards and removed.

1. To dismantle coin mechanism:

- A) Remove center screw.
- B) Remove sprocket.
- C) Remove three(4) mounting screws.
- D) Pull back plate away from face plate.
- E) Remove jammed coin.
- F) Replace parts in step A-F in reverse order.

Figure 4 coin mechanism Exploded view illustration for adjustment and maintenance only.
coin mechanism parts not sold separately.

Figure 4

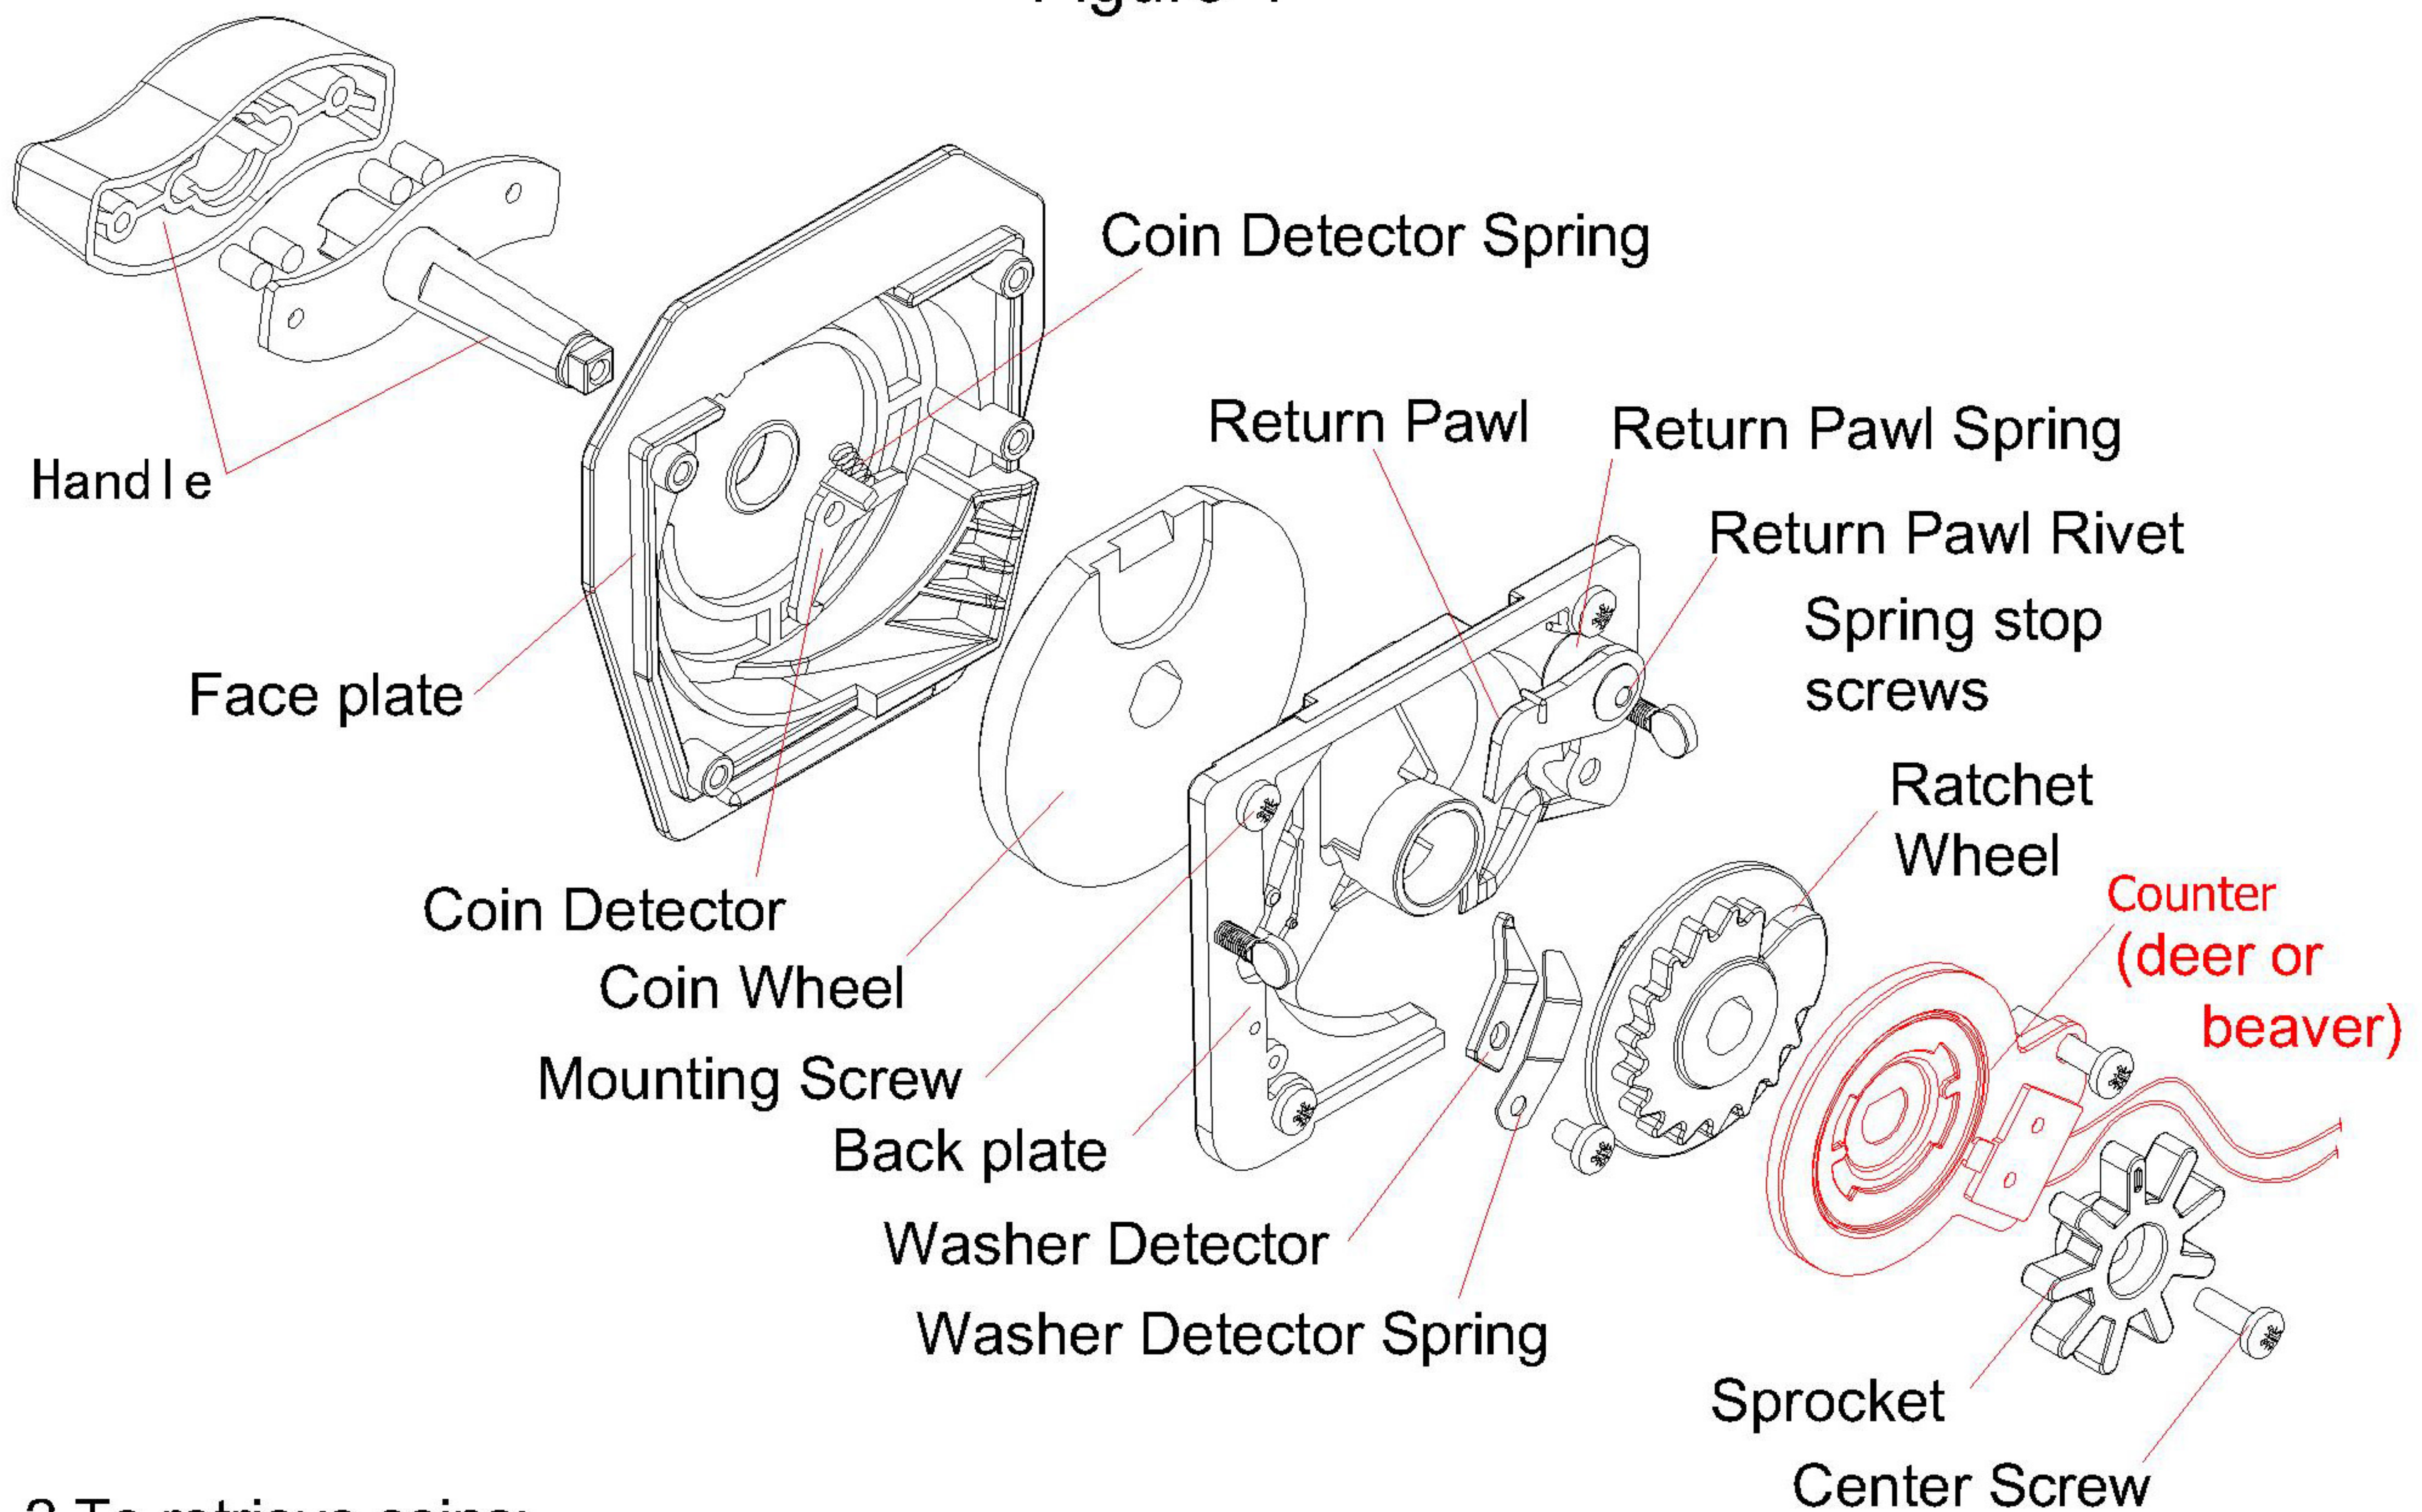

2. To retrieve coins:

- A) Unlock and remove front panel assembly, Pull cash box.
- B) Retrieve coin from cash box.
- C) Replace and tighten front panel lock.

Note: do not overtighten the lock as only a snug fit is necessary.

Heavy Duty Cast Iron Stand

The Heavy Duty Iron Stand itself consists of three(3)main parts.
The Base threaded Pipe.and threaded Flange.

1.For Single Mount:

- A.)Place the threaded pipe into the threaded opening on the Pedestal Base and tighten
- B.)Place the Threaded Flange onto Threded Pipe .Flat side up.
- C.)Secure the Pedestal Base and tighten the Threded Flange by turning Clockwise
- D.)Disassemble vendor to free Base(See: Coin Retrieval)
- E.)Align holes in vendor's Base to the large holes in the Threaded Flange.
(Fig.5)Note:The front of the Base has a notch for the product Chute.
- F.)Insert two(2)bolts From threaded Flange through Base.
- G.)Apply washers and nuts.Tighten.**DO NOT OVER THGTHTEN.**
- H.)Reassemble vendor .

Figure 5 Heavy Duty Cast Iron Stand Mounting

Single Mount

Double Mount

Base

Base

Threaded Flange

Bracket Tube

Pedestal Tube

2.Remove Instruction & Diagram for Double Mount:

- A.)Complete steps A-D as shown in Single Mount.
- B.)Place Large Double Bracket on top,and align large holes in threaded Flange holes in large Double Bracket.(Fig. 5)
- C.)Insert bolts as shown.(Fig.5)
- D.)Disassemble both Vendors to free Base.(See:Coin Retrieval)
- E.)Align Front an rear most holes in Base to the outer most holes in the Large Double Bracktk.(Fig.5)Note:The front of the Base has a notch for in the product Chute
- F.)Insert two(2)bolts(Per vendor)down from the large Double Bracket.
- G.)Apply washers and nuts.Tighten.**DO NOT OVER THGTHTEN-OVER TIGHTENING CAN CRACK THE BASE AND VOID WARRANTY.**
- H.)Reassemble vendors.